



RSG

May Creek

2023 RESERVE STUDY MAY CREEK CLUB

Gold Bar, WA 98251

Financial Year 2023 (June 1, 2022 - May 31, 2023)

Level 3 Update without Site Visit

02/25/22

NO UNLICENSED
VEHICLES ON
OUR ROAD WAY
OR RIGHT OF
WAYS

VEHICLES WILL BE
TOWED WITHOUT
WARNING OR NOTICE

WWW.RONMAYTOWING.COM
UNAUTHORIZED OR IMPROPERLY PARKED
VEHICLES WILL BE IMPOUNDED AT
OWNER'S RISK & EXPENSE 24 HRS A DAY

RON MAY
425-259-9264 * 1-800-TOW-TO-GO
"We Keep Snohomish County Moving"
TOWING • JUMPSTARTS • LOCKOUTS
2406 39th St. • EVERETT, WA

CRIME WATCH
NEIGHBORHOOD
CALL 911

Attention Dogs
Grrrr. Aarr. Woff.
Woof dog.
Attention
Dog Owners
Please pick up after
your dogs. Thank you.



A New Strategy for Reserve Funding.

Our reserve study approach is simple. We provide you with the insight needed to make fast, accurate and informed decisions. We focus on understanding your situation and providing funding solutions that are designed with your goals in mind. By focusing on the detail and the big picture we provide the information you need to best manage your reserve fund and annual contributions.

As a long-term capital budget plan, the reserve study identifies the current status of the reserve fund and whether contributions to the fund are adequate to address future needs. The report helps the Association make necessary decisions regarding the development of their reserve fund and establish expectations in relation to the timing and cost of significant repair and replacement projects.

The reserve study recommends funding through smaller monthly contributions rather than risking large, unanticipated special assessments. Regular and ongoing reserve contributions are favored over special assessment as they help distribute expenses equally between current and future owners, and establish a stable contribution rate.

The reserve study contains 'forward looking' concepts which reflect expectations with respect to certain future events and potential financial performance. Although we believe at this time that the expectations reflected within the reserve study are reasonable, no assurances can be given that such expectations will prove correct. We recommend that the reserve study be updated annually to address changing circumstances and conditions.



6 CONTRIBUTION RANGE

Funding programs and strategies that are available to the Association.



14 PERCENT FUNDED

How well funded is the Association's reserve fund.

4 EXECUTIVE SUMMARY

Summary of reserve study outcomes and property related data.

5 KEY INSIGHTS

Snapshot of key data points, highlighting the strength of current funding strategies.

9 CURRENT FUNDING SUMMARY

Summary of current funding strategies and projected outcomes.

10 METHODOLOGY

The what, when, when and how of the reserve study process.

14 FINANCIAL ANALYSIS

Percent funded and the strength of the reserve account.

16 RESERVE COMPONENT LIST

List of reserve components, anticipated cost, remaining, and useful life estimates.

18 RESERVE EXPENSES

Projected expenses over the coming 30 years.

24 FULL FUNDING PLAN

Recommended funding plan and cash flow projection.

27 PHYSICAL ANALYSIS

Specific information regarding the physical condition of the property.



EXECUTIVE SUMMARY

PROPERTY SUMMARY

ASSOCIATION NAME	May Creek Club
LOCATION	Gold Bar, WASHINGTON 98251
YEAR CONSTRUCTED	1966
NUMBER OF UNITS	360
FINANCIAL YEAR	2023 (June 1, 2022 - May 31, 2023)
REPORT LEVEL	Level 3 Update without Site Visit

RESERVE FUND

PROJECT STARTING BALANCE ¹	\$18,000
FULLY FUNDED BALANCE, IDEAL	\$163,263
CURRENT PER UNIT DEFICIENCY/(SURPLUS) IN RESERVES	\$404
PERCENT FUNDED ²	11 %
INTEREST EARNED	1.00 %
INFLATION RATE ³	3.00 %

RESERVE CONTRIBUTIONS

CURRENT RESERVE FUND CONTRIBUTION	\$5,000
FULL FUNDING, MAXIMUM CONTRIBUTION	\$38,146
BASELINE FUNDING, MINIMUM CONTRIBUTION	\$41,029
SPECIAL ASSESSMENT	\$0

¹ Information in relation to the Association's finances were supplied by the Association's representative and is not audited.

² The ratio, at a particular point of time (the beginning of the Fiscal Year), of the actual (or projected) Reserve Balance to the Fully Funded Balance, expressed as a percentage (www.caionline.org). Used to highlight the strength of the Association's reserve fund.

³ Inflation rate is based upon the average annual increase of the Consumer Price Index (CPI) over the last 30-years, as published by the US Bureau of Labor Statistics (www.labor.gov).




KEY INSIGHTS

\$18,000	\$5,000	\$1,338,496
RESERVE ACCOUNT BALANCE	ANNUAL RESERVE CONTRIBUTION	PROJECTED EXPENSES OVER 30 YEARS

FULL FUNDING STRATEGY

Annual member contributions to the reserve fund are used to address those expenses too large or infrequent to be addressed through annual operating funds. The chart below highlights the outcome of the Full Funding strategy over the mid-to-long term.

YEAR 1-30 EXPENSES
\$1,338,496

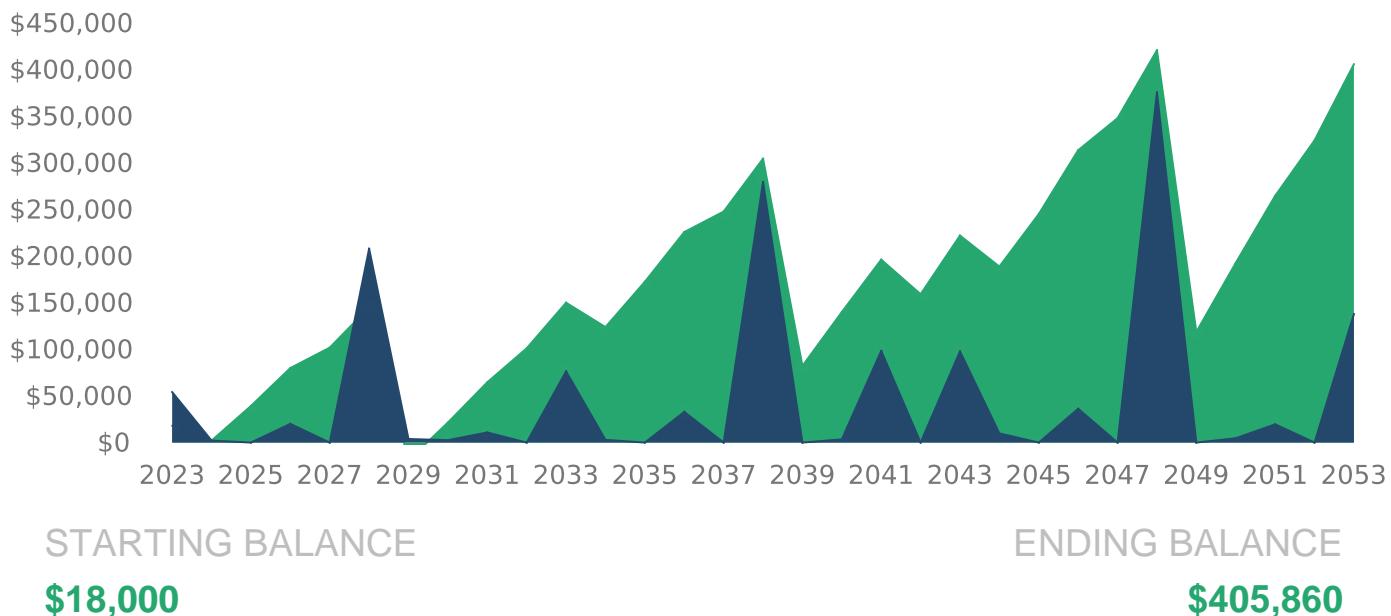

Note: Figures based upon the expectation that the Association will continue to increase member contributions by an inflationary rate of 3.00% annually. Year-over-year change the result of projected expenses on the Association's reserve account.



CONTRIBUTION RANGE

We recommend that reserve contributions be evenly distributed between members over the life of a community. To achieve this goal, we establish an ideal contribution range within which the Association should establish ongoing payments.

\$41,029

MINIMUM
BASELINE FUNDING

\$38,146

MAXIMUM
FULL FUNDING

\$5,000

CURRENT FUNDING

FUNDING STRATEGIES

The funding strategy chosen will have a direct impact on the growth of the Association's reserve fund. The chart below highlights the outcomes of the various funding strategies.



Note: Figures based upon the expectation that the Association will continue to increase member contributions by an inflationary rate of 3.00% annually. Year-over-year change the result of projected expenses on the Association's reserve account.



FULL FUNDING PLAN | SUMMARY

Year	Fully Funded Balance	Percentage Funded	Beginning Balance	Reserve Contribution	Special Assessment	Interest Earned	Reserve Expenditures	Ending Balance
2023	\$163,263	11%	\$18,000	\$38,146	\$0	\$100	\$54,144	\$2,102
2024	\$141,886	1%	\$2,102	\$39,100	\$0	\$206	\$2,163	\$39,245
2025	\$174,293	23%	\$39,245	\$40,077	\$0	\$593	\$0	\$79,915
2026	\$210,812	38%	\$79,915	\$41,079	\$0	\$904	\$20,062	\$101,836
2027	\$228,700	45%	\$101,836	\$42,106	\$0	\$1,229	\$0	\$145,171
2028	\$268,757	54%	\$145,171	\$43,159	\$0	\$628	\$207,918	-\$18,960
2029	\$96,855	0%	-\$18,960	\$44,238	\$0	\$12	\$3,821	\$21,469
2030	\$131,042	16%	\$21,469	\$45,344	\$0	\$429	\$2,583	\$64,659
2031	\$168,587	38%	\$64,659	\$46,477	\$0	\$825	\$10,831	\$101,131
2032	\$199,850	51%	\$101,131	\$47,639	\$0	\$1,250	\$0	\$150,019
2033	\$244,328	61%	\$150,019	\$48,830	\$0	\$1,363	\$76,326	\$123,886
2034	\$212,679	58%	\$123,886	\$50,051	\$0	\$1,475	\$2,907	\$172,505
2035	\$256,891	67%	\$172,505	\$51,302	\$0	\$1,982	\$0	\$225,789
2036	\$306,649	74%	\$225,789	\$52,585	\$0	\$2,356	\$32,895	\$247,835
2037	\$325,278	76%	\$247,835	\$53,900	\$0	\$2,748	\$0	\$304,483
2038	\$379,649	80%	\$304,483	\$55,247	\$0	\$1,924	\$279,425	\$82,229
2039	\$149,181	55%	\$82,229	\$56,628	\$0	\$1,105	\$0	\$139,963
2040	\$200,985	70%	\$139,963	\$58,044	\$0	\$1,672	\$3,471	\$196,208
2041	\$252,188	78%	\$196,208	\$59,495	\$0	\$1,768	\$98,316	\$159,156
2042	\$208,699	76%	\$159,156	\$60,982	\$0	\$1,896	\$0	\$222,035
2043	\$266,678	83%	\$222,035	\$62,507	\$0	\$2,044	\$97,790	\$188,796
2044	\$227,223	83%	\$188,796	\$64,070	\$0	\$2,159	\$9,860	\$245,165
2045	\$278,751	88%	\$245,165	\$65,671	\$0	\$2,780	\$0	\$313,616
2046	\$343,627	91%	\$313,616	\$67,313	\$0	\$3,292	\$36,235	\$347,986
2047	\$374,822	93%	\$347,986	\$68,996	\$0	\$3,825	\$0	\$420,807
2048	\$446,021	94%	\$420,807	\$70,721	\$0	\$2,684	\$375,523	\$118,689
2049	\$134,366	88%	\$118,689	\$72,489	\$0	\$1,549	\$0	\$192,727
2050	\$202,002	95%	\$192,727	\$74,301	\$0	\$2,275	\$4,665	\$264,639
2051	\$268,772	98%	\$264,639	\$76,159	\$0	\$2,929	\$19,562	\$324,165
2052	\$324,165	100%	\$324,165	\$78,063	\$0	\$3,632	\$0	\$405,860

\$38,146

2023
ANNUAL CONTRIBUTION

2.50 %

PERCENTAGE ANNUAL
CONTRIBUTION INCREASE

1.00 %

ANNUAL
INTEREST RATE



BASELINE FUNDING PLAN | SUMMARY

Year	Fully Funded Balance	Percentage Funded	Beginning Balance	Reserve Contribution	Special Assessment	Interest Earned	Reserve Expenditures	Ending Balance
2023	\$163,263	11%	\$18,000	\$41,029	\$0	\$114	\$54,144	\$4,999
2024	\$141,886	4%	\$4,999	\$42,054	\$0	\$249	\$2,163	\$45,140
2025	\$174,293	26%	\$45,140	\$43,106	\$0	\$667	\$0	\$88,913
2026	\$210,812	42%	\$88,913	\$44,183	\$0	\$1,010	\$20,062	\$114,043
2027	\$228,700	50%	\$114,043	\$45,288	\$0	\$1,367	\$0	\$160,698
2028	\$268,757	60%	\$160,698	\$46,420	\$0	\$799	\$207,918	\$0
2029	\$96,855	0%	\$0	\$47,581	\$0	\$219	\$3,821	\$43,979
2030	\$131,042	34%	\$43,979	\$48,770	\$0	\$671	\$2,583	\$90,837
2031	\$168,587	54%	\$90,837	\$49,990	\$0	\$1,104	\$10,831	\$131,100
2032	\$199,850	66%	\$131,100	\$51,239	\$0	\$1,567	\$0	\$183,906
2033	\$244,328	75%	\$183,906	\$52,520	\$0	\$1,720	\$76,326	\$161,820
2034	\$212,679	76%	\$161,820	\$53,833	\$0	\$1,873	\$2,907	\$214,619
2035	\$256,891	84%	\$214,619	\$55,179	\$0	\$2,422	\$0	\$272,220
2036	\$306,649	89%	\$272,220	\$56,559	\$0	\$2,841	\$32,895	\$298,724
2037	\$325,278	92%	\$298,724	\$57,973	\$0	\$3,277	\$0	\$359,974
2038	\$379,649	95%	\$359,974	\$59,422	\$0	\$2,500	\$279,425	\$142,471
2039	\$149,181	96%	\$142,471	\$60,907	\$0	\$1,729	\$0	\$205,107
2040	\$200,985	102%	\$205,107	\$62,430	\$0	\$2,346	\$3,471	\$266,412
2041	\$252,188	106%	\$266,412	\$63,991	\$0	\$2,493	\$98,316	\$234,580
2042	\$208,699	112%	\$234,580	\$65,591	\$0	\$2,674	\$0	\$302,844
2043	\$266,678	114%	\$302,844	\$67,230	\$0	\$2,876	\$97,790	\$275,160
2044	\$227,223	121%	\$275,160	\$68,911	\$0	\$3,047	\$9,860	\$337,259
2045	\$278,751	121%	\$337,259	\$70,634	\$0	\$3,726	\$0	\$411,618
2046	\$343,627	120%	\$411,618	\$72,400	\$0	\$4,297	\$36,235	\$452,080
2047	\$374,822	121%	\$452,080	\$74,210	\$0	\$4,892	\$0	\$531,182
2048	\$446,021	119%	\$531,182	\$76,065	\$0	\$3,815	\$375,523	\$235,538
2049	\$134,366	175%	\$235,538	\$77,967	\$0	\$2,745	\$0	\$316,250
2050	\$202,002	157%	\$316,250	\$79,916	\$0	\$3,539	\$4,665	\$395,039
2051	\$268,772	147%	\$395,039	\$81,914	\$0	\$4,262	\$19,562	\$461,654
2052	\$324,165	142%	\$461,654	\$83,961	\$0	\$5,036	\$0	\$550,651

\$41,029

2023
ANNUAL CONTRIBUTION

2.50 %

PERCENTAGE ANNUAL
CONTRIBUTION INCREASE

1.00 %

ANNUAL
INTEREST RATE



CURRENT FUNDING PLAN | SUMMARY

Year	Fully Funded Balance	Percentage Funded	Beginning Balance	Reserve Contribution	Special Assessment	Interest Earned	Reserve Expenditures	Ending Balance
2023	\$163,263	11%	\$18,000	\$5,000	\$0	\$0	\$54,144	-\$31,144
2024	\$141,886	0%	-\$31,144	\$5,125	\$0	\$0	\$2,163	-\$28,182
2025	\$174,293	0%	-\$28,182	\$5,253	\$0	\$0	\$0	-\$22,929
2026	\$210,812	0%	-\$22,929	\$5,384	\$0	\$0	\$20,062	-\$37,607
2027	\$228,700	0%	-\$37,607	\$5,519	\$0	\$0	\$0	-\$32,088
2028	\$268,757	0%	-\$32,088	\$5,657	\$0	\$0	\$207,918	-\$234,349
2029	\$96,855	0%	-\$234,349	\$5,798	\$0	\$0	\$3,821	-\$232,371
2030	\$131,042	0%	-\$232,371	\$5,943	\$0	\$0	\$2,583	-\$229,011
2031	\$168,587	0%	-\$229,011	\$6,092	\$0	\$0	\$10,831	-\$233,750
2032	\$199,850	0%	-\$233,750	\$6,244	\$0	\$0	\$0	-\$227,505
2033	\$244,328	0%	-\$227,505	\$6,400	\$0	\$0	\$76,326	-\$297,431
2034	\$212,679	0%	-\$297,431	\$6,560	\$0	\$0	\$2,907	-\$293,778
2035	\$256,891	0%	-\$293,778	\$6,724	\$0	\$0	\$0	-\$287,053
2036	\$306,649	0%	-\$287,053	\$6,893	\$0	\$0	\$32,895	-\$313,056
2037	\$325,278	0%	-\$313,056	\$7,065	\$0	\$0	\$0	-\$305,991
2038	\$379,649	0%	-\$305,991	\$7,241	\$0	\$0	\$279,425	-\$578,174
2039	\$149,181	0%	-\$578,174	\$7,423	\$0	\$0	\$0	-\$570,752
2040	\$200,985	0%	-\$570,752	\$7,608	\$0	\$0	\$3,471	-\$566,614
2041	\$252,188	0%	-\$566,614	\$7,798	\$0	\$0	\$98,316	-\$657,132
2042	\$208,699	0%	-\$657,132	\$7,993	\$0	\$0	\$0	-\$649,138
2043	\$266,678	0%	-\$649,138	\$8,193	\$0	\$0	\$97,790	-\$738,735
2044	\$227,223	0%	-\$738,735	\$8,398	\$0	\$0	\$9,860	-\$740,197
2045	\$278,751	0%	-\$740,197	\$8,608	\$0	\$0	\$0	-\$731,589
2046	\$343,627	0%	-\$731,589	\$8,823	\$0	\$0	\$36,235	-\$759,001
2047	\$374,822	0%	-\$759,001	\$9,044	\$0	\$0	\$0	-\$749,958
2048	\$446,021	0%	-\$749,958	\$9,270	\$0	\$0	\$375,523	-\$1,116,211
2049	\$134,366	0%	-\$1,116,211	\$9,501	\$0	\$0	\$0	-\$1,106,710
2050	\$202,002	0%	-\$1,106,710	\$9,739	\$0	\$0	\$4,665	-\$1,101,635
2051	\$268,772	0%	-\$1,101,635	\$9,982	\$0	\$0	\$19,562	-\$1,111,215
2052	\$324,165	0%	-\$1,111,215	\$10,232	\$0	\$0	\$0	-\$1,100,983

\$5,000

2023
ANNUAL CONTRIBUTION

2.50 %

PERCENTAGE ANNUAL
CONTRIBUTION INCREASE

1.00 %

ANNUAL
INTEREST RATE



METHODOLOGY

An important aspect of living in a common area development such as a cooperative, condominium, or homeowner Association is the community's ownership and commitment to maintain its common areas.

Association members have a vested interest in maintaining and preserving their investment. To meet these obligations, the Association should prudently prepare for the future and contribute funds into a reserve account. Periodic contributions provide the freedom to gradually accumulate funds for anticipated expenditures while limiting the need to raise large sums of money through alternative means, such as special assessments.

When implementing a policy to fund major repair or replacement, the Board must educate owners about the benefits of accumulating reserve funds in advance through periodic contributions. Benefits of a systematic accumulation of funds include:

- having assurance that funds for major repairs and replacements will be available when needed;
- development of an equitable method of charging both current and future owners for ongoing use of assets;
- preservation of the market value of individual units; and
- compliance with the governing documents, statutes, mortgages, and other similar requirements.

A reserve study recommends the preferable mode of funding through smaller monthly contributions rather than facing large, unanticipated special assessments. The reserve study provides an Association with access to information and materials that will assist them in making timely and informed decisions about their reserve fund and contributions.

A reserve study is the sum of two parts: the physical and financial analysis. The physical analysis is a result of the on-site collection and review of data specific to the property's reserve components, common areas, and limited common areas. Through an onsite inspection and the use of source materials, the Reserve Specialist quantifies and establishes the reserve component inventory and assesses the physical condition of the Association's reserve components. Data from the physical analysis is used to define the scope and timing of future anticipated expenses.

The financial analysis evaluates the condition of the Association's reserve fund in relation to its income and anticipated expenses. It appraises the adequacy of the reserve fund, and associated member contributions, against the current and future expenditures of the Association. To adequately forecast these expenditures over the 30-year projection period, current costs, projected inflation, and interest rates must be established. Recommendations are then provided to establish a reserve fund that addresses anticipated expenses, without having to resort to special assessments.

Due to the long-term nature of a reserve study, certain assumptions must be made. Every effort has been made to ensure that the recommendations are based upon reliable and experienced sources in the building industry. However, there can be no guarantee that events will occur at the predicted specific intervals, or that they will occur at all. Any reserve study must be viewed in the light of circumstances existing at the actual time of the study.



PHYSICAL ANALYSIS

As part of this reserve study a comprehensive list of reserve components (major common and limited common elements) has been compiled. Estimates for the useful life, remaining life, plus current repair and replacement costs for each of these reserve components have been calculated. This list is not intended to be exhaustive. However, an inaccurate or incomplete list of components can have an adverse impact upon the Association's long-term funding plan.

Site Inspection

A site inspection is conducted to assess the general condition of the property and its common areas. The on-site inspection is visual in nature, and no destructive or invasive testing is conducted. Observations are recorded using a representative sampling of the Association's common areas and reserve components. The component inventory and associated field measurements are also substantiated as part of the inspection.

Reserve Components

Determination of what constitutes a reserve component is dependent on a number of factors. A four-part test is generally used to distinguish a reserve item from an operational or maintenance expense. A component is included as a reserve item only if it satisfies ALL criteria outlined below:

- It is part of the Association's common and limited common area responsibilities.
- It has a predictable useful service life.
- Its useful life fits within the projection period. This means that components with a life of 30 years or more may not be included as part of the report if it is determined that they will last beyond the projection period.
- Its cost for repair or replacement is too high to include as part of the operating budget.

The components of common property that an Association includes in its reserve funding plan are also dependent on the type of project, the construction properties and the Association's applicable governing documents and state statutes.

Component Useful Life

The useful life of a reserve component relates to the number of years it is expected to last, given reasonable care and maintenance. The prediction of reserve and building component life can be no more than an informed estimate based upon information made available at the time of the report's development. Consideration is given to vendor recommendations, material warranty information provided at the time of the report's development, along with other published sources. The data and service life estimates in this report are based on information gathered from various groups and industry sources as outlined below:

- Historical data and feedback from the Association;
- Management groups and maintenance managers;
- Manufacturer recommendations and industry standards;
- Published sources of service life data;
- Manufacturers' and suppliers' data.



Component Remaining Useful Life

The remaining life of a reserve component refers to the number of years left before an item's expected repair or replacement. A component's remaining life is contingent upon the following factors:

- Age/years in service;
- Physical condition;
- Frequency and quality of inspections and maintenance;
- General use;
- Environment, impact of weather and building location;
- Installation methods that meets or exceed industry standards;
- Design and quality of materials used.

In addition to deterioration or anticipated failure of a component, the longevity may be impacted by obsolescence. The accuracy of the estimate is contingent upon reliable information made available at the time of the report's development. It is important to note that even with the highest degree of diligence and experience, outcomes will vary, and no guarantee can be given as to the timing or service life of the reserve components. All service life assessments in this report are based on the assumption that installation is carried out in accordance with manufacturer's recommendations and installation instructions, together with industry standards of workmanship.

FINANCIAL ANALYSIS

An Association, like any business entity, must prepare financially for the replacement and repair of its assets. Reserve study funding analysis is an important part of the annual budget process. Reserve funding should be reviewed at least once annually to help determine the annual assessment to be charged to members. The following elements are used in the financial analysis.

Recommended Funding Rate

We advocate a program of regular reserve fund contributions and promote a gradual means of reserving for future repair and replacement expenses. Recommended contributions are set at a level where they require only minor annual increases. The rate is designed to distribute the anticipated cost of common property ownership equitably between all members over the entire projection period.

Fully Funded Balance

The Fully Funded balance is equal to the total depreciable cost of all the Association's reserve components. It is determined by dividing each reserve component's cost by its useful life, and multiplying that by the number of years the component has been in service (effectively its age). In essence, the depreciated or 'used up' value of a component is utilized to establish an amount that the Association should have saved by a particular time. The recommendations in this report are based upon a Full Funding plan, which sets the goal of achieving one hundred percent fully funded reserves by the end of the 30-year projection period. We advocate full funding as we feel that this approach provides a solid platform to address future needs, thus dramatically reducing the need for special assessment.



Percent Funded

An Association's reserve fund status is assessed by comparing the ratio of actual or projected funds available versus how much they 'should have saved'. The result is presented as a percentage and is commonly known as "percent funded". In other words, percent funded is calculated by dividing the Association's current reserve fund balance by the fully funded balance. This equation is an industry measure of how well prepared an Association is to meet its current and future repair and replacement obligations. Percent funded highlights the strength of the Association's reserve account in relation to the anticipated costs of repair and replacement.

Reserve Component Cost

Current cost estimates for reserve components are derived from a variety of sources but typically are based on cost data sourced from national construction estimators (R.S. Means) and vendor pricing acquired from regional contractors and suppliers. All cost estimates formulated from national estimators are based upon the latest specific geographical information for the area. Future cost estimates are determined by applying the assumed annual inflation rate to the current cost of each component.

Individual cost estimates are for budgeting purposes only. Actual construction costs can vary significantly due to economies of scale, material availability, labor, seasonal considerations, and other factors beyond our control. We recommend that project costs be substantiated well in advance of the anticipated date of repair and replacement. A detailed evaluation by a qualified professional should also be undertaken to establish the scope and budget of each project.

Cost estimates do not account for permits, architectural, or project management fees that may be required. Allowances and contingencies must also be added to the total as the scope of work is defined.

Inflation Rate

The effect of inflation on the cost of reserve components is a key factor in the financial projections. Historically, the cost of construction materials and labor rise at a higher rate than that experienced by the general economy. RSG has chosen to use an inflationary multiplier that is somewhat higher than the current general consumer index for inflation. The rate used is based upon the historical average of inflation over the last 30 years. This rate reflects a realistic appreciation of future costs for reserve components and assists the Association in adequately budgeting for increasing cost.

Interest Rate

The interest rate used in this report is formulated on a conservative rate of return. Unless otherwise advised by the Association, an assumed net interest rate of 1.00% is used. RSG offers no guarantee or opinion in relation to investment decisions made by the Association or the rate of return achieved.

Current Reserve Fund Balance


The analysis, recommendations, and financial projections made within this report are heavily reliant on information provided by the Association and its representatives. The starting reserve fund balance (current or projected) and member contribution totals are supplied by these sources. This information has not been audited nor have the financial projections or recommendations.

FINANCIAL ANALYSIS

This section of the report is intended to provide the association with the awareness to adequately plan for the ongoing major maintenance, repair and replacement of their common property components. The recommendations included within this report represent one scenario, and are not intended to represent the only means of achieving the association's goals. We recommend that the Board of Directors use the following information as a guide in planning for their future objectives.

Percent Funded

The Percent Funded equation is the industry measure of how well prepared an association is to meet its current and future repair and replacement obligations. Percent funded highlights the strength of the association's reserve account in relation to its anticipated costs of repair and replacement. The higher the funded level, the less exposed an association is to market conditions, unanticipated expenses or events, and fluctuations in the general economy.

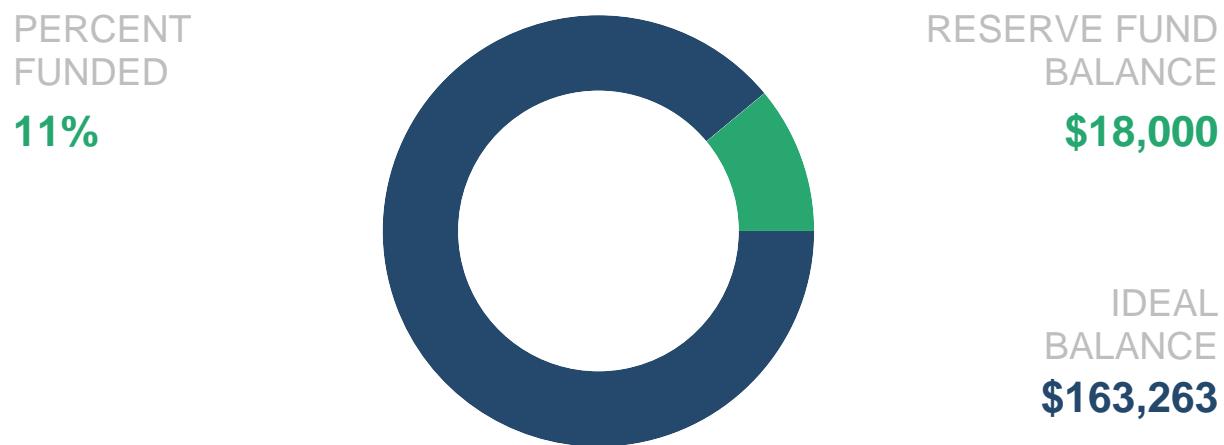

An Association at or below a funding level of 30% has an increased risk of requiring special assessments to meet their ongoing obligations, as compared to Associations with higher funding levels. A level of funding at and above 60% is categorized as good or well funded. We recommend that associations look to achieve and maintain funding levels at and above 60%, with a preference to being 100% funded.



Funding Goals

There is a range of funding alternatives available to the association. In our opinion the strategy chosen should not only meet the immediate needs and risk tolerance of current members, but also the longer term needs of the association.

The association needs to establish a reserve contribution rate which, at a minimum, meets their anticipated financial needs without having to resort to special assessment or deferred maintenance. In addition, the funding goal needs to be prudent enough to meet the expectations of current members while not unfairly burdening future owners.



FULL FUNDING

Establishes a goal of achieving one hundred percent fully funded reserves by the end of the projection period.

THRESHOLD FUNDING

Sets out to keep the cash reserves above a specified dollar or percent funded amount for the duration of the projection period.

BASELINE FUNDING

Establishes a goal of maintaining a reserve account balance above zero dollars throughout the study period.

The minimum funding goal needed to meet planned expenditure is Baseline Funding. Baseline Funding maintains the reserve account at or above zero dollars, but leaves the association with no contingency to address unanticipated outcomes. Threshold funding is a strategy designed to provide for this contingency by keeping cash reserves above a specific dollar amount or percent funded level.

The reserve fund plan highlighted in this report is based upon the Full Funding program of reserve contributions. The Full Funding plan highlights an ideal level of contributions which will enable an association to be 100% funded by the end of the projection period. As stated previously, we recommend that the association implement a program that moves them toward and maintains a funding level of 60-100%.



RESERVE COMPONENT LIST

Component	Useful Life	Remaining Useful Life	Quantity	Unit of Measure	Unit Cost	Current Cost
General Site						
General Site - Asphalt Repair & Seal Coat	5	0	338400	SF	\$0.16	\$54,144
General Site - Asphalt Repair & Overlay [20% Limited]	10	5	338400	SF	\$1.85	\$125,208
General Site - Signage, Entry Monument	15	6	1	Allowance	\$3,200.00	\$3,200
General Site - Bridge, Inspect & Repair	5	3	1	Allowance	\$5,300.00	\$5,300
Goldbar Dr Nth						
General Site - Fence, Chain Link 6'	25	13	440	LF	\$30.00	\$13,200
General Site - Seating, Bench	20	13	1	Each	\$975.00	\$975
General Site - Park Shelter, Replace	30	18	1	Lump Sum	\$10,700.00	\$10,700
General Site - Park Shelter, Maintain	10	1	1	Allowance	\$2,100.00	\$2,100
General Site - Playground, Swing	20	10	1	Each	\$2,650.00	\$2,650
General Site - Playground, Spring Rider	20	3	2	Each	\$955.00	\$1,910
General Site - Playground, Slide	20	3	1	Each	\$3,200.00	\$3,200
General Site - Basketball Court, Equipment	20	8	1	Lump Sum	\$3,250.00	\$3,250
Goldbar Dr Sth						
General Site - Fence, Chain Link 6'	25	18	400	LF	\$30.00	\$12,000
General Site - Fence, Chain Link 3'	25	18	50	LF	\$25.00	\$1,250
General Site - Seating, Bench	20	13	2	Each	\$975.00	\$1,950
General Site - Park Shelter, Replace	30	18	1	Lump Sum	\$15,900.00	\$15,900
General Site - Park Shelter, Maintain	10	7	1	Allowance	\$2,100.00	\$2,100
General Site - Playground, Swing	20	3	1	Each	\$4,250.00	\$4,250
General Site - Playground, See Saw & Slide	20	3	1	Each	\$3,700.00	\$3,700
Mountain View PI E						
General Site - Fence, Chain Link 6'	25	18	420	LF	\$30.00	\$12,600
General Site - Seating, Bench	20	13	1	Each	\$975.00	\$975
TOTALS						\$280,562

Readers should be aware that certain property elements are considered 'long life' elements and are not accounted for within the reserve study in conjunction with elements that are or can be managed as part of the Association's operating budget.

Cost estimates do not account for permits, architectural, or project management fees that may be required. Allowances and contingencies must also be added to the total as the scope of work is defined.



FULLY FUNDED BALANCE

Component	Current Cost	Current Fully Funded Balance	Annual Cost	% Annual Cost
General Site				
General Site - Asphalt Repair & Seal Coat	\$54,144	\$54,144	\$10,829	37.82%
General Site - Asphalt Repair & Overlay [20% Limited]	\$125,208	\$62,604	\$12,521	43.73%
General Site - Signage, Entry Monument	\$3,200	\$1,920	\$213	0.75%
General Site - Bridge, Inspect & Repair	\$5,300	\$2,120	\$1,060	3.70%
Goldbar Dr Nth				
General Site - Fence, Chain Link 6'	\$13,200	\$6,336	\$528	1.84%
General Site - Seating, Bench	\$975	\$341	\$49	0.17%
General Site - Park Shelter, Replace	\$10,700	\$4,280	\$357	1.25%
General Site - Park Shelter, Maintain	\$2,100	\$1,890	\$210	0.73%
General Site - Playground, Swing	\$2,650	\$1,325	\$133	0.46%
General Site - Playground, Spring Rider	\$1,910	\$1,624	\$96	0.33%
General Site - Playground, Slide	\$3,200	\$2,720	\$160	0.56%
General Site - Basketball Court, Equipment	\$3,250	\$1,950	\$163	0.57%
Goldbar Dr Sth				
General Site - Fence, Chain Link 6'	\$12,000	\$3,360	\$480	1.68%
General Site - Fence, Chain Link 3'	\$1,250	\$350	\$50	0.17%
General Site - Seating, Bench	\$1,950	\$683	\$98	0.34%
General Site - Park Shelter, Replace	\$15,900	\$6,360	\$530	1.85%
General Site - Park Shelter, Maintain	\$2,100	\$630	\$210	0.73%
General Site - Playground, Swing	\$4,250	\$3,613	\$213	0.74%
General Site - Playground, See Saw & Slide	\$3,700	\$3,145	\$185	0.65%
Mountain View PI E				
General Site - Fence, Chain Link 6'	\$12,600	\$3,528	\$504	1.76%
General Site - Seating, Bench	\$975	\$341	\$49	0.17%
TOTALS	\$280,562	\$163,263	\$28,635	100%



RESERVE EXPENSES 1-5 YEARS

Component	2023	2024	2025	2026	2027
General Site					
General Site - Asphalt Repair & Seal Coat	\$54,144	\$0	\$0	\$0	\$0
General Site - Asphalt Repair & Overlay [20% Limited]	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monument	\$0	\$0	\$0	\$0	\$0
General Site - Bridge, Inspect & Repair	\$0	\$0	\$0	\$5,791	\$0
Goldbar Dr Nth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$2,163	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Spring Rider	\$0	\$0	\$0	\$2,087	\$0
General Site - Playground, Slide	\$0	\$0	\$0	\$3,497	\$0
General Site - Basketball Court, Equipment	\$0	\$0	\$0	\$0	\$0
Goldbar Dr Sth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Fence, Chain Link 3'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$4,644	\$0
General Site - Playground, See Saw & Slide	\$0	\$0	\$0	\$4,043	\$0
Mountain View PI E					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
Annual Expenditure	\$54,144	\$2,163	\$0	\$20,062	\$0



RESERVE EXPENSES 6-10 YEARS

Component	2028	2029	2030	2031	2032
General Site					
General Site - Asphalt Repair & Seal Coat	\$62,768	\$0	\$0	\$0	\$0
General Site - Asphalt Repair & Overlay [20% Limited]	\$145,150	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monument	\$0	\$3,821	\$0	\$0	\$0
General Site - Bridge, Inspect & Repair	\$0	\$0	\$0	\$6,714	\$0
Goldbar Dr Nth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Spring Rider	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Slide	\$0	\$0	\$0	\$0	\$0
General Site - Basketball Court, Equipment	\$0	\$0	\$0	\$4,117	\$0
Goldbar Dr Sth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Fence, Chain Link 3'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$2,583	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, See Saw & Slide	\$0	\$0	\$0	\$0	\$0
Mountain View PI E					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
Annual Expenditure	\$207,918	\$3,821	\$2,583	\$10,831	\$0



RESERVE EXPENSES 11-15 YEARS

Component	2033	2034	2035	2036	2037
General Site					
General Site - Asphalt Repair & Seal Coat	\$72,765	\$0	\$0	\$0	\$0
General Site - Asphalt Repair & Overlay [20% Limited]	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monument	\$0	\$0	\$0	\$0	\$0
General Site - Bridge, Inspect & Repair	\$0	\$0	\$0	\$7,783	\$0
Goldbar Dr Nth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$19,385	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$1,432	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$2,907	\$0	\$0	\$0
General Site - Playground, Swing	\$3,561	\$0	\$0	\$0	\$0
General Site - Playground, Spring Rider	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Slide	\$0	\$0	\$0	\$0	\$0
General Site - Basketball Court, Equipment	\$0	\$0	\$0	\$0	\$0
Goldbar Dr Sth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Fence, Chain Link 3'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$2,864	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, See Saw & Slide	\$0	\$0	\$0	\$0	\$0
Mountain View PI E					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$1,432	\$0
Annual Expenditure	\$76,326	\$2,907	\$0	\$32,895	\$0



RESERVE EXPENSES 16-20 YEARS

Component	2038	2039	2040	2041	2042
General Site					
General Site - Asphalt Repair & Seal Coat	\$84,355	\$0	\$0	\$0	\$0
General Site - Asphalt Repair & Overlay [20% Limited]	\$195,070	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monument	\$0	\$0	\$0	\$0	\$0
General Site - Bridge, Inspect & Repair	\$0	\$0	\$0	\$9,023	\$0
Goldbar Dr Nth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$18,216	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Spring Rider	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Slide	\$0	\$0	\$0	\$0	\$0
General Site - Basketball Court, Equipment	\$0	\$0	\$0	\$0	\$0
Goldbar Dr Sth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$20,429	\$0
General Site - Fence, Chain Link 3'	\$0	\$0	\$0	\$2,128	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$27,069	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$3,471	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, See Saw & Slide	\$0	\$0	\$0	\$0	\$0
Mountain View PI E					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$21,451	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
Annual Expenditure	\$279,425	\$0	\$3,471	\$98,316	\$0



RESERVE EXPENSES 21-25 YEARS

Component	2043	2044	2045	2046	2047
General Site					
General Site - Asphalt Repair & Seal Coat	\$97,790	\$0	\$0	\$0	\$0
General Site - Asphalt Repair & Overlay [20% Limited]	\$0	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monument	\$0	\$5,953	\$0	\$0	\$0
General Site - Bridge, Inspect & Repair	\$0	\$0	\$0	\$10,460	\$0
Goldbar Dr Nth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$3,907	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Spring Rider	\$0	\$0	\$0	\$3,770	\$0
General Site - Playground, Slide	\$0	\$0	\$0	\$6,315	\$0
General Site - Basketball Court, Equipment	\$0	\$0	\$0	\$0	\$0
Goldbar Dr Sth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Fence, Chain Link 3'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$8,388	\$0
General Site - Playground, See Saw & Slide	\$0	\$0	\$0	\$7,302	\$0
Mountain View PI E					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
Annual Expenditure	\$97,790	\$9,860	\$0	\$36,235	\$0





RESERVE EXPENSES 26-30 YEARS

Component	2048	2049	2050	2051	2052
General Site					
General Site - Asphalt Repair & Seal Coat	\$113,366	\$0	\$0	\$0	\$0
General Site - Asphalt Repair & Overlay [20% Limited]	\$262,158	\$0	\$0	\$0	\$0
General Site - Signage, Entry Monument	\$0	\$0	\$0	\$0	\$0
General Site - Bridge, Inspect & Repair	\$0	\$0	\$0	\$12,126	\$0
Goldbar Dr Nth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Spring Rider	\$0	\$0	\$0	\$0	\$0
General Site - Playground, Slide	\$0	\$0	\$0	\$0	\$0
General Site - Basketball Court, Equipment	\$0	\$0	\$0	\$7,436	\$0
Goldbar Dr Sth					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Fence, Chain Link 3'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Replace	\$0	\$0	\$0	\$0	\$0
General Site - Park Shelter, Maintain	\$0	\$0	\$4,665	\$0	\$0
General Site - Playground, Swing	\$0	\$0	\$0	\$0	\$0
General Site - Playground, See Saw & Slide	\$0	\$0	\$0	\$0	\$0
Mountain View PI E					
General Site - Fence, Chain Link 6'	\$0	\$0	\$0	\$0	\$0
General Site - Seating, Bench	\$0	\$0	\$0	\$0	\$0
Annual Expenditure	\$375,523	\$0	\$4,665	\$19,562	\$0



FULL FUNDING PLAN 1-10 YEARS



YEAR 1-10	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032
Fully Funded Balance	\$163,263	\$141,886	\$174,293	\$210,812	\$228,700	\$268,757	\$96,855	\$131,042	\$168,587	\$199,850
Percentage Funded (%)	11%	1%	23%	38%	45%	54%	0%	16%	38%	51%
Beginning Balance	\$18,000	\$2,102	\$39,245	\$79,915	\$101,836	\$145,171	-\$18,960	\$21,469	\$64,659	\$101,131
Reserve Contribution	\$38,146	\$39,100	\$40,077	\$41,079	\$42,106	\$43,159	\$44,238	\$45,344	\$46,477	\$47,639
Avg Unit Contribution (mth)	\$8.83	\$9.05	\$9.28	\$9.51	\$9.75	\$9.99	\$10.24	\$10.50	\$10.76	\$11.03
Contribution Increase (%)	0.00%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%
Special Assessment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Interest Earned	\$100	\$206	\$593	\$904	\$1,229	\$628	\$12	\$429	\$825	\$1,250
Reserve Expenditures	\$54,144	\$2,163	\$0	\$20,062	\$0	\$207,918	\$3,821	\$2,583	\$10,831	\$0
ENDING BALANCE	\$2,102	\$39,245	\$79,915	\$101,836	\$145,171	-\$18,960	\$21,469	\$64,659	\$101,131	\$150,019

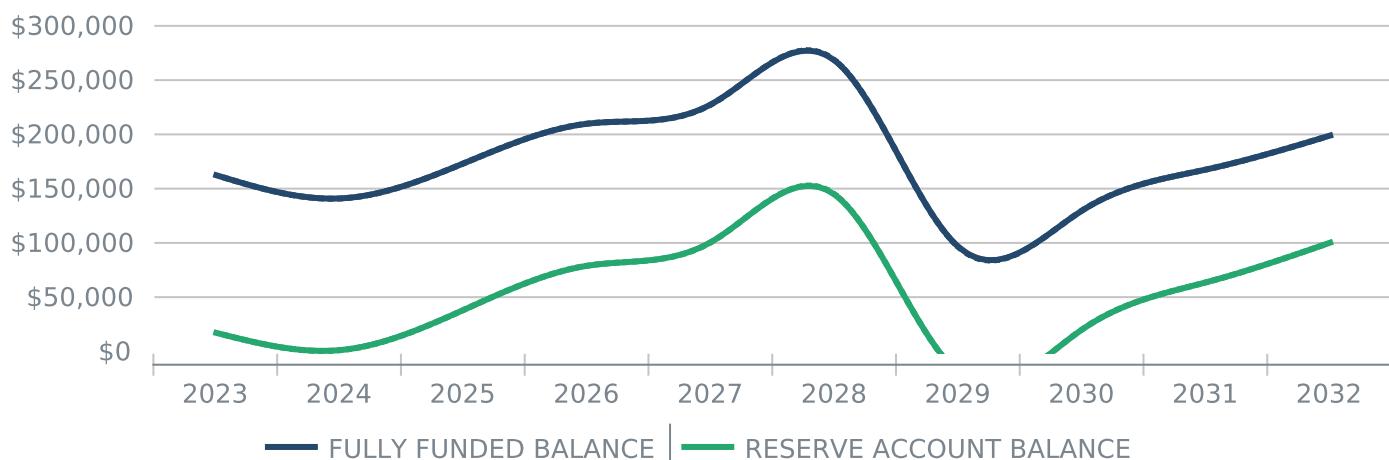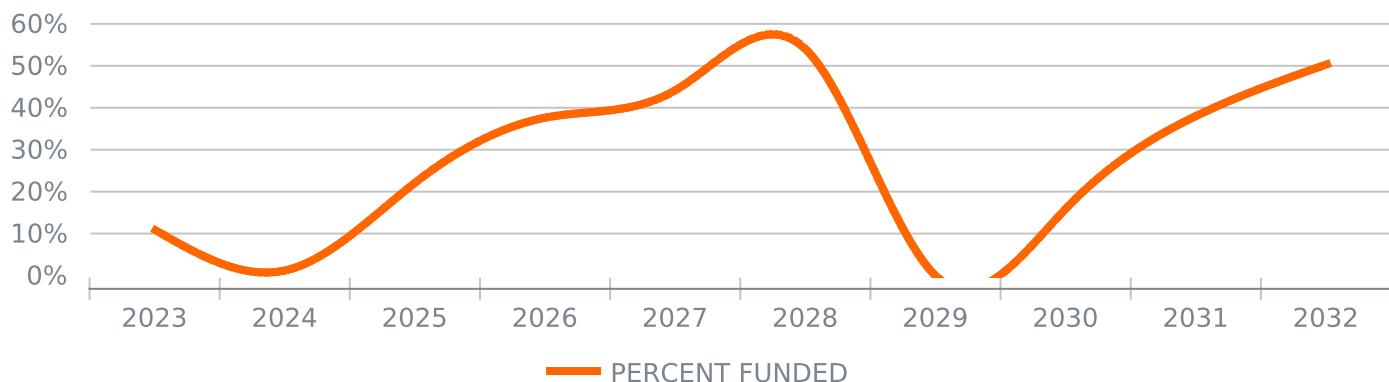



FULL FUNDING PLAN 11-20 YEARS



YEAR 11-20	2033	2034	2035	2036	2037	2038	2039	2040	2041	2042
Fully Funded Balance	\$244,328	\$212,679	\$256,891	\$306,649	\$325,278	\$379,649	\$149,181	\$200,985	\$252,188	\$208,699
Percentage Funded (%)	61%	58%	67%	74%	76%	80%	55%	70%	78%	76%
Beginning Balance	\$150,019	\$123,886	\$172,505	\$225,789	\$247,835	\$304,483	\$82,229	\$139,963	\$196,208	\$159,156
Reserve Contribution	\$48,830	\$50,051	\$51,302	\$52,585	\$53,900	\$55,247	\$56,628	\$58,044	\$59,495	\$60,982
Avg Unit Contribution (mth)	\$11.30	\$11.59	\$11.88	\$12.17	\$12.48	\$12.79	\$13.11	\$13.44	\$13.77	\$14.12
Contribution Increase (%)	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%
Special Assessment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Interest Earned	\$1,363	\$1,475	\$1,982	\$2,356	\$2,748	\$1,924	\$1,105	\$1,672	\$1,768	\$1,896
Reserve Expenditures	\$76,326	\$2,907	\$0	\$32,895	\$0	\$279,425	\$0	\$3,471	\$98,316	\$0
ENDING BALANCE	\$123,886	\$172,505	\$225,789	\$247,835	\$304,483	\$82,229	\$139,963	\$196,208	\$159,156	\$222,035

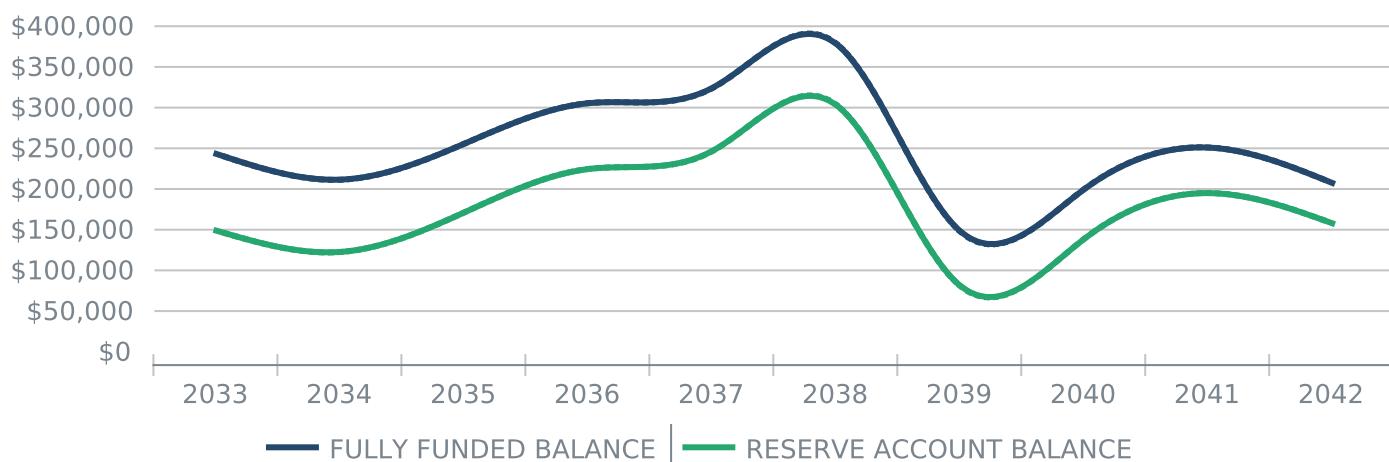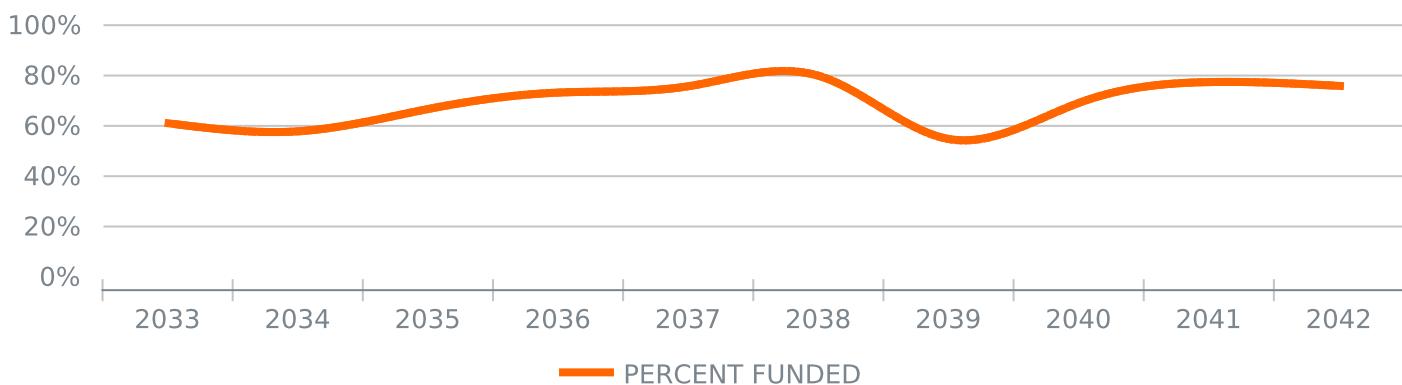



FULL FUNDING PLAN 21-30 YEARS

YEAR 21-30	2043	2044	2045	2046	2047	2048	2049	2050	2051	2052
Fully Funded Balance	\$266,678	\$227,223	\$278,751	\$343,627	\$374,822	\$446,021	\$134,366	\$202,002	\$268,772	\$324,165
Percentage Funded (%)	83%	83%	88%	91%	93%	94%	88%	95%	98%	100%
Beginning Balance	\$222,035	\$188,796	\$245,165	\$313,616	\$347,986	\$420,807	\$118,689	\$192,727	\$264,639	\$324,165
Reserve Contribution	\$62,507	\$64,070	\$65,671	\$67,313	\$68,996	\$70,721	\$72,489	\$74,301	\$76,159	\$78,063
Avg Unit Contribution (mth)	\$14.47	\$14.83	\$15.20	\$15.58	\$15.97	\$16.37	\$16.78	\$17.20	\$17.63	\$18.07
Contribution Increase (%)	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%	2.50%
Special Assessment	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Interest Earned	\$2,044	\$2,159	\$2,780	\$3,292	\$3,825	\$2,684	\$1,549	\$2,275	\$2,929	\$3,632
Reserve Expenditures	\$97,790	\$9,860	\$0	\$36,235	\$0	\$375,523	\$0	\$4,665	\$19,562	\$0
ENDING BALANCE	\$188,796	\$245,165	\$313,616	\$347,986	\$420,807	\$118,689	\$192,727	\$264,639	\$324,165	\$405,860

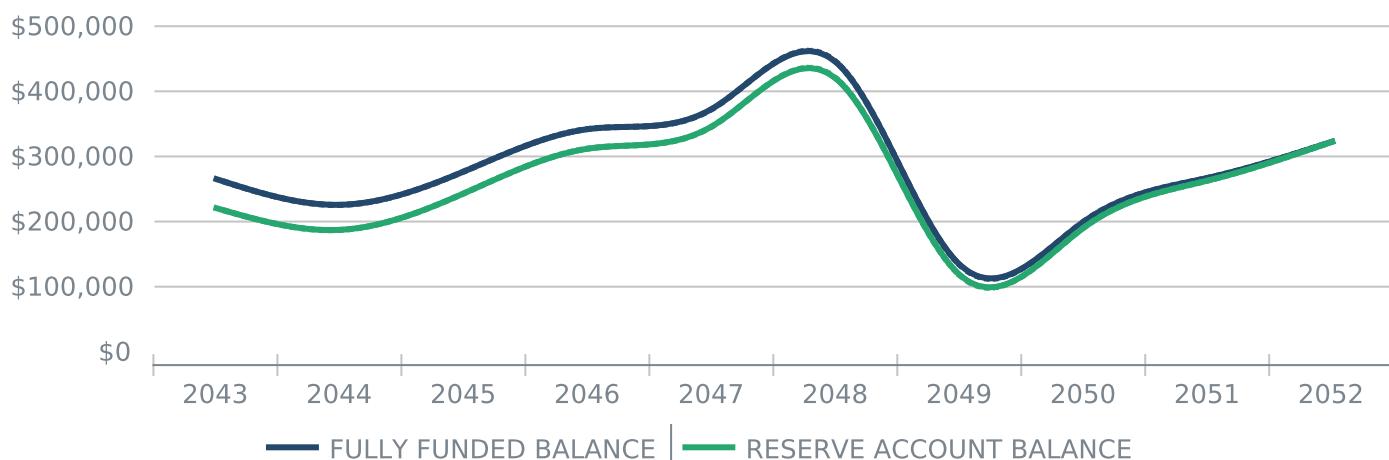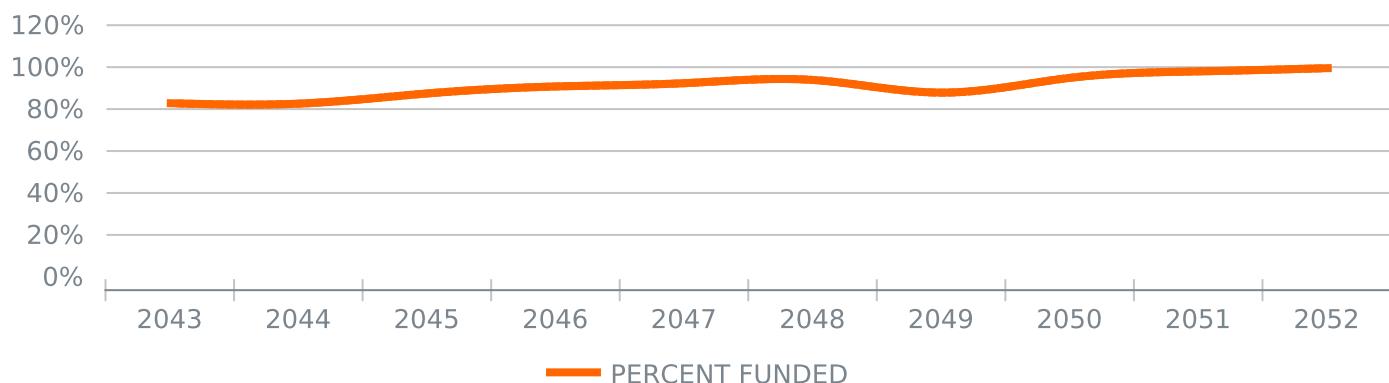



DISCLOSURES

As a guideline for establishing and spending reserves, it is assumed that the reserve study will be regularly updated to address the Association's changing physical and financial circumstances. As such this report is valid at the date shown and Reserve Study Group, LLC (RSG) cannot be held responsible for subsequent changes in physical/chemical environmental conditions and/or legislation over which we have no control.

This reserve study is based on visual inspections of the physical plant's major components. No invasive or destructive testing, or testing of materials was conducted during the inspections, or at any other time during the preparation of this report. It is assumed that all building and ancillary components have been designed and constructed properly and that life cycles will approximate normal industry performance standards. RSG shall not be responsible for accurate determination of remaining life expectancies of components that may have been improperly designed and constructed. Our opinions of the remaining life expectancy of the property's components do not represent a guarantee or warranty of performance in relation to the product, materials or workmanship.

Cost estimates used represent a preliminary opinion only and are neither a quote nor a warranty of actual costs that may be incurred. These estimates are based on typical cost data that may not fully characterize the scope of the underlying property conditions. It should be anticipated that actual cost outcomes will be impacted by varying physical and economic conditions, maintenance practices, changes in technology, and future regulatory actions.

The authors of this report make no representation or warranty, expressed or implied, with respect to the contents of this publication or any part thereof and cannot accept any legal responsibility or liability for any inaccuracies, errors or omissions contained in this publication or any part thereof. Our best professional judgment has been used, however certain facts forming the basis of this report are subject to professional interpretation and differing conclusions could be reached.

RSG nor any of its representatives, agents or employees maintain management roles or vested interest in, or have other business relationships with the Association. There is no perceived or actual conflicts of interest between RSG and the Association. Our reserve studies are prepared by a reserve study professional and also comply with the requirements of the Washington Unified Common Interest Act (WUCIOA).

This reserve study should be reviewed carefully. It may not include all common and limited common element components that will require major maintenance, repair, or replacement in future years, and may not include regular contributions to a reserve account for the cost of such maintenance, repair, or replacement. The failure to include a component in a reserve study, or to provide contributions to a reserve account for a component, may, under some circumstances, require the association to (1) defer major maintenance, repair, or replacement, (2) increase future reserve contributions, (3) borrow funds to pay for major maintenance, repair, or replacement, or (4) impose special assessments for the cost of major maintenance, repair, or replacement.



GLOSSARY OF TERMS

Component

The individual line items in the Reserve Study which are included in the Physical Analysis. These elements form the building blocks for the Reserve Study.

Estimated Useful Life

The estimated time, in years, that a reserve component can be expected to serve its intended function if properly constructed in its present application or installation.

Fully Funded

When the actual (or projected) Reserve balance is equal to the Fully Funded Balance.

Fully Funded Balance (FFB)

The Reserve balance that is in direct proportion to the fraction of life "used up" of the current Repair or Replacement cost. This number is calculated for each component, then summed together for an Association total.

FFB = Current Cost x Effective Age / Useful Life

Percent Funded

The ratio, at a particular point of time, of the actual Reserve Balance to the Fully Funded Balance (FFB), expressed as a percentage.

Remaining Useful Life

The estimated time, in years, that a Reserve Component can be expected to continue to service its intended function. Projects anticipated to occur in the initial year have a "zero" Remaining Life.

Unit Cost Estimate

The cost of replacing, repairing, or restoring a Reserve Component to its original functional condition. The Current Replacement Cost would be the cost to replace, repair, or restore the component during the current year.

Unit of Measure

Various units of measure have been used to quantify the amounts and costs in relation to each reserve component. Below are the key units used as part of this report.

SF = Square Foot

SY = Square Yard

LF = Linear Foot

SQUARE = 100 Square Feet (Roofing)

Reserve Study Group, LLC
www.reservestudygroup.com

